

Tech Tip



From your friends at New York Bus Sales

Product Affected –Short units with only 1 roof hatch

Complaint: *Right side turn signals are not working or work intermittently*

Cause: *Wiring where it crosses body to the right is goes across along rthe same panel where the roof hatch is and may rub through on the stringers for the roof hatch and cause a short.*

Correction: *Quickest way is to pull down the interior roof hatch trim and check the stringers which run on either side of the hatch at the roof bows. If you see wires running through at that point make sure they have not rubbed through. In most cases there will be grommets but we have found instances where the wires run between the stringer and bow which over time may rub through and short.*

Thanks to Rick and the guys at Horseheads Central School for pointing this out!

Contact Our Service Department With Any Questions

CHITTENANGO – phone 800-962-5768 or

Daryl Wallace : dwallace@newyorkbussales.com

Brian Lamaitis : blamaitis@newyorkbussales.com

ROCHESTER – phone 800-463-3232 or

Gary Chichester: gchichester@newyorkbussales.com

ALBANY – phone 866-867-1100 or

Ben Reiling: breiling@newyorkbussales.com

Steve Searles: ssearles@newyorkbussales.com

WARRANTY – 800-962-5768 ext 237



ALL of our Tech Tips can be found on the New York Bus Sales website at

<http://www.newyorkbussales.com/pages/bulletins.cfm>

Or at the New York Head Mechanic website at

<http://www.nyhma.org/viewforum.php?f=2&start=0>

