

Tech Tip

FROM YOUR FRIENDS AT
NEW YORK BUS SALES!



BBCV Radiator Isolators

- Complaint –** There is a clicking noise in the front end especially on turns.
- Cause –** On older units we have seen the side mounted radiator isolators, #4 in FIGURE #1 for Diesel units and #3 in FIGURE #2 for Propane units, come apart causing the radiator to “lift” in turns and then settle back down, which may cause the “clicking” noise in turns. Looking at the unit during a normal PM you would not notice that there was any issue. If they have separated they could separate as shown in FIGURE #3.
- Correction –** During PM inspections lifting on the radiator or at the isolators on the frame rail to assure they have not split will ensure there are no issues. If they have split it would be recommended to change both to ensure no further problemsa new one is shown in FIGURE #4

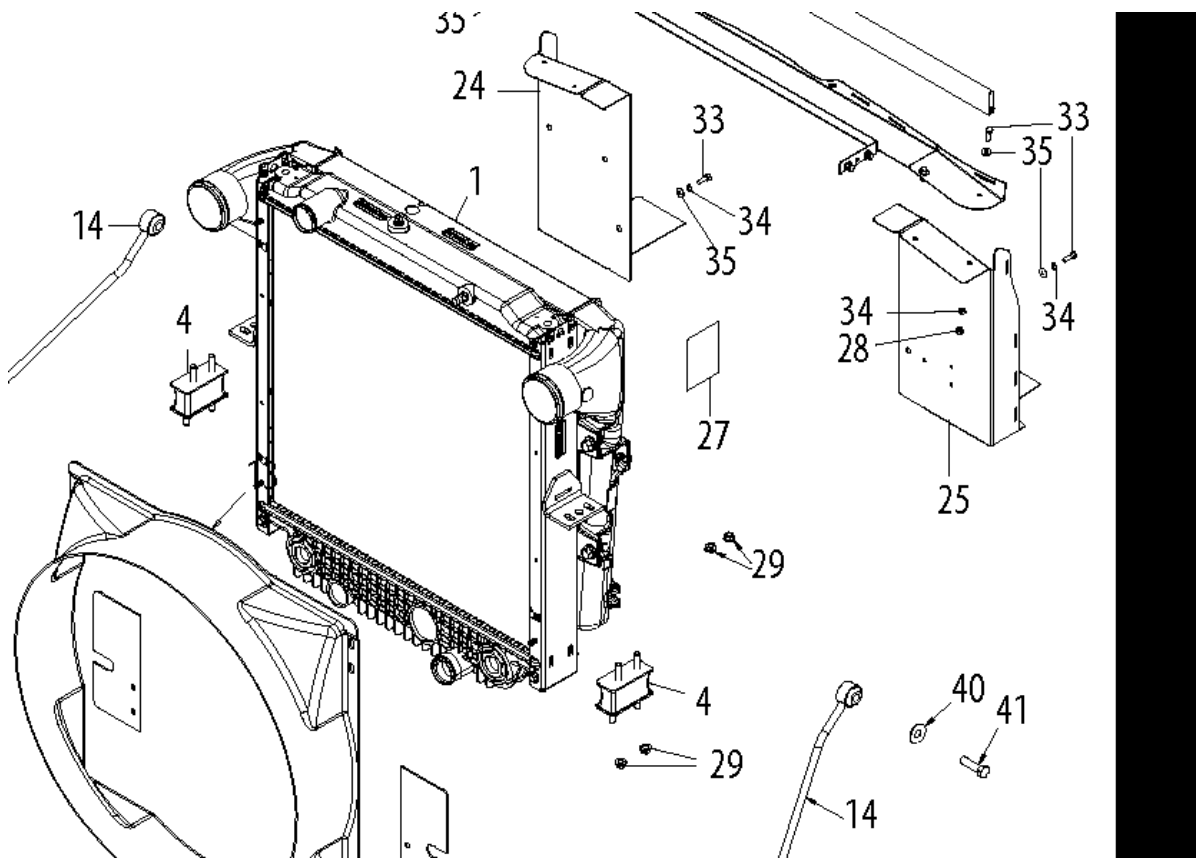


FIGURE #1

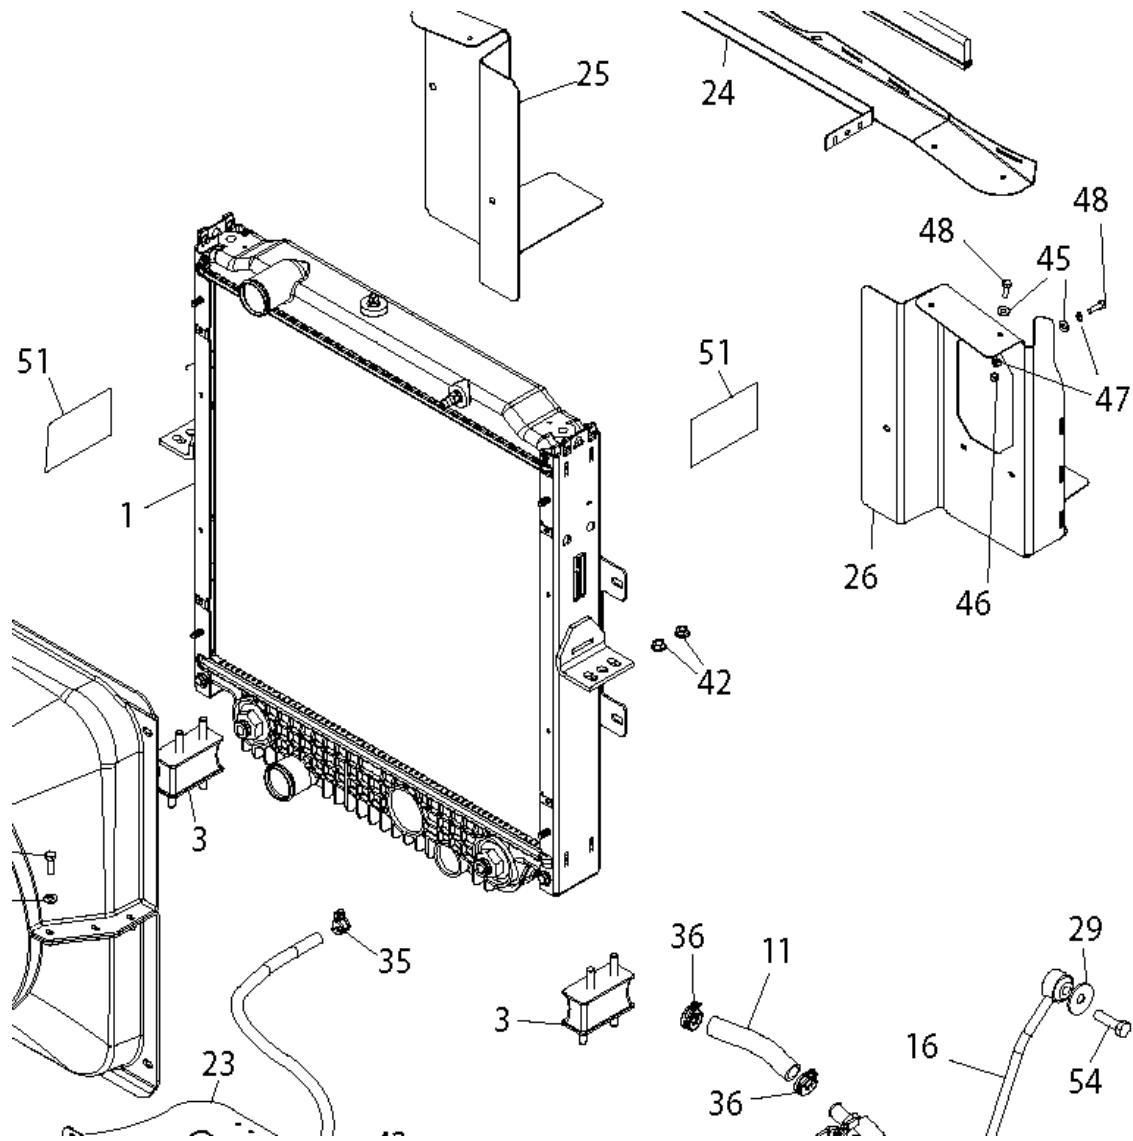


FIGURE #2



FIGURE #3

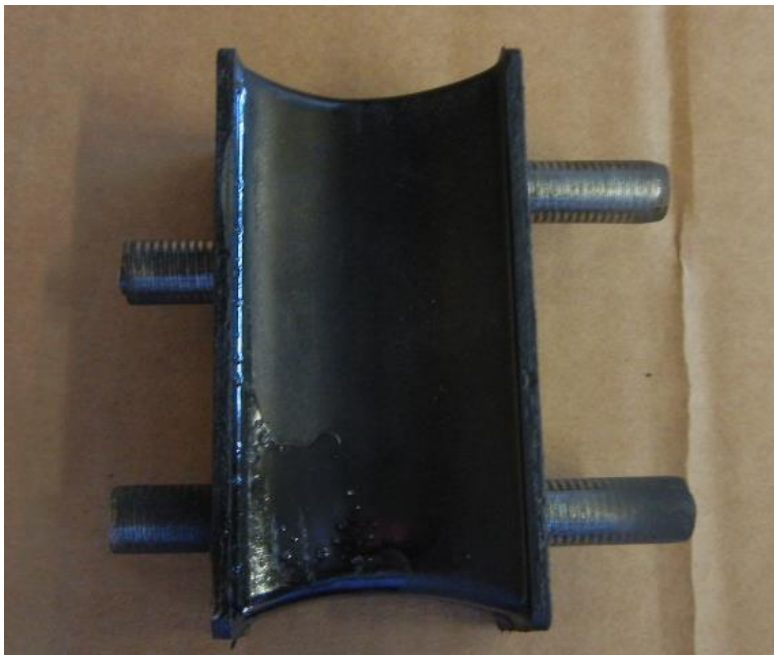


FIGURE #4

**THANK YOU TO HARRY &
JEREMY FROM DUANESBURG
CENTRAL SCHOOL FOR
BRINGING THIS TO OUR
ATTENTION!!!**

ISOLATOR PART # 00048444



Contact Our Service Department With Any Questions

CHITTENANGO – phone 800-962-5768 or
Daryl Wallace : dwallace@newyorkbussales.com
Brian Lamaitis : blamaitis@newyorkbussales.com

ROCHESTER – phone 800-463-3232 or
Gary Chichester: gchichester@newyorkbussales.com

ALBANY – phone 866-867-1100 or
Ben Reiling: breiling@newyorkbussales.com

WARRANTY – 800-962-5768 ext 237
Morgan Jenkins: mjenkins@newyorkbussales.com

Or Your Customer Support Representative
West

Michael Panzica – mpanzica@newyorkbussales.com
Cell 716-908-3186

Central

Jeremie “JJ” Richmond –
jrichmond@newyorkbussales.com

Cell 315-559-3999

East

Gary Bigness – gbigness@newyorkbussales.com
Cell 845-500-3707

ALL of our Tech Tips can be found on the New York Bus Sales website at
<http://www.newyorkbussales.com/pages/bulletins.cfm>
Or at the New York Head Mechanic website at
<http://www.nyhma.org/viewforum.php?f=2&start=0>