

Tech Tip



From your friends at New York Bus Sales

Complaint - My bus leaks in the front during heavy rainstorms.

Cause - With the sometime torrential downpours that we seem to be having more and more of, the “static vent” which is designed to allow air inside the bus to equalize with the outside pressure acts as a way for this water to enter and leak into the passenger compartment.

Correction - New York Bus Sales has designed a “deflector” to help minimize water entry during these downpours.
Shown in figures #1 and 2 you can see how the deflector covers the louvers of the vent but clearly still allows air to flow so the operation of the vent is not compromised.
Figure #3 shows this installed on a unit – As you can see from all the figures this easily mounts with 4-1/8” rivets.
We have begun installing these on new units being delivered and if you wish to upgrade your older vehicles, we have these available through our Parts Department.

PLEASE NOTE – These style vents are only on Type C and D. The Microbird Type A has a different design-

<i>PART NUMBER</i>	<i>PRICE</i>
<i>NYB-26</i>	<i>\$14.00</i>



Figure #1



Figure #2

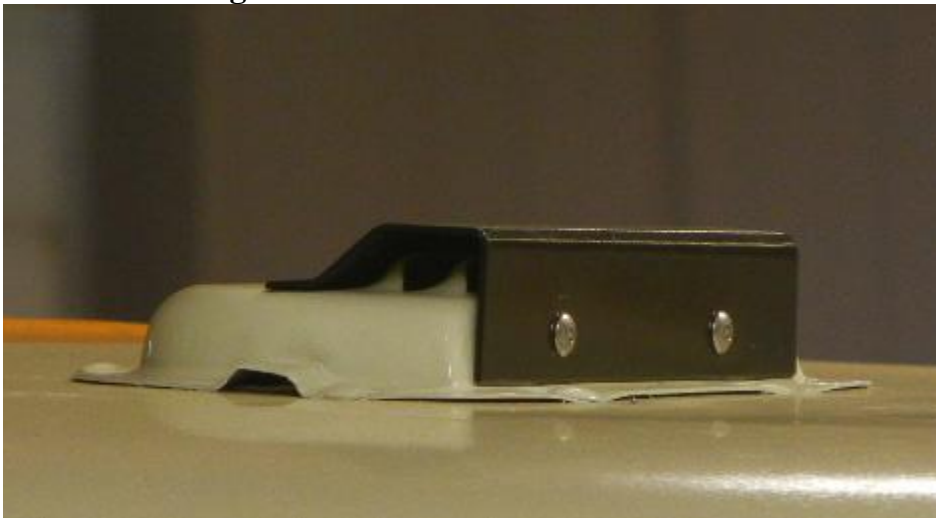


Figure #3



NEW YORK BUS SALES

Contact Our Service Department With Any Questions

CHITTENANGO – phone 800-962-5768 or
Daryl Wallace : dwallace@newyorkbussales.com

Brian Lamaitis : blamaitis@newyorkbussales.com

ROCHESTER – phone 800-463-3232 or
Gary Chichester: gchichester@newyorkbussales.com

ALBANY – phone 866-867-1100 or

Ben Reiling: breiling@newyorkbussales.com

Steve Searles: ssearles@newyorkbussales.com

WARRANTY – 800-962-5768 ext 237

Morgan Jenkins: mjenkins@newyorkbussales.com

ALL of our Tech Tips can be found on the New York Bus Sales website at

<http://www.newyorkbussales.com/pages/bulletins.cfm>

Or at the New York Head Mechanic website at

<http://www.nyhma.org/viewforum.php?f=2&start=0>

